

# American Property Inspections of Texas

Phone: 281-744-3965

Email: [RScarborough@APITX.net](mailto:RScarborough@APITX.net)

[www.apitx.net](http://www.apitx.net)

## PROPERTY INSPECTION REPORT

---

Prepared For: Mr. & Mrs. Customer

Concerning: 6013 ABC Houston, TX.

Inspected By: Rod Scarborough TREC License # 7189 September 3, 2011

---

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at [www.trec.state.tx.us](http://www.trec.state.tx.us).

The TREC Standards of Practice (Sections 535.227-535.231 of the rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is not required to move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector will note which systems and components were Inspected (I), Not Inspected (NI), Not Present (NP), and/or Deficient (D). General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing parts, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported as Deficient may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards, form OP-I.

This property inspection is not an exhaustive inspection of the structure, systems, or components. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

Items identified in the report do not obligate any party to make repairs or take other action, nor is the purchaser required to request that the seller take any action. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that property repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance for the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated

information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

## ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

### Property information provided by customer/HAR

Inspection Type: Single Family Residence Year built: 2011 Stories: 2 Approx: 2,400 SF Bed / Bath: 3/2.5

Inspection Start Time: 9:30 End Time: 1:00

Present at Inspection: Buyer Buyers Agent Seller Sellers Agent

Building Status: Vacant Contractors/Cleaning Crew on Site During the Inspection

Weather Conditions: Sunny Cloudy Rain Approx. Outside Temperature: 90 Degrees

Utilities On: Yes No Gas No Water No Power



For the purpose of this report and all references within, the direction of the structure faces north. All references to direction within the report will be based on this information.

All opinions, observations or findings (whether listed as "I, NI, NP or D") in this report are based solely on the time and date of the actual inspection. This report has been paid for and prepared for by the client/clients named above and is not valid without a signed service agreement provided for review at the time of the inspection and is non transferable without the written consent of the inspector performing the inspection.

This inspection is not an engineering report, and should not be considered one. If any cause for concern is noted on the report, or if you would like further evaluation, you should consider an evaluation by a licensed engineer.

How to read and interpret this report: It is the opinion of the inspector that items below marked with a  should be addressed. These items may be in need of repair/correction, may be a priority item or may possibly indicate non-compliance with current building standards and may need to be monitored on a continual basis. All items marked with a  should be addressed to client's satisfaction prior to closing. Pictures may be inserted below an item marked with a  to give a visual description of an item found as having a deficiency. The inspector does not give recommendations on items marked with a deficiency. however the inspector may express an opinion about a deficiency.

Mold/Mildew investigations are not included in this report. It is beyond the scope of this inspection.

**Comments underlined in bold lettering within the report are generally FYI (for your information) and may not require any action.**

---

Promulgated by the Texas Real Estate Commission (TREC) P.O. Box 12188, Austin, TX 78711-2188, 1-800-250-8732 or (512) 459-6544 (<http://www.trec.state.tx.us>). REI 7A-1 (10/2008)



Front of home

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**I. STRUCTURAL SYSTEMS**

**A. Foundations**

**Foundation Type(s):** Slab On Grade

Comments:

The performance of the foundation described within this report does not in anyway address future settlement or movement. Due to the expansive nature of the soil in the Houston area it is recommended that the foundation be monitored on a regular basis and the moisture content of the soil surrounding the foundation be kept at a consistant level.

The inspection of the foundation is limited to the visual observation of the accessible exterior and interior structural components at the time of the inspection. The inspector does not perform engineering studies or measurments. There are many factors which could limit the accuracy of the assessment of foundation performance. These include but may not be limited to: landscaping, patios, painting, repairs, areas behind walls, furnishing, decking, ect.

Foundation movement usually tends to produce a few large cracks, usually at least 1/16<sup>th</sup> inch wide, rather than a lot of small cracks. Cracks in brick veneer due to foundation movement will normally extend from the top of the wall to the bottom of the wall.

Cracking usually will be tapered if caused by foundation movement. By tapered I mean that the crack will be wider at the top or the bottom. If a crack is due to foundation movement, it will almost never be the same width at the top and bottom; such a crack is more likely to be due to thermal stresses than to foundation movement.

Considered as a whole, the pattern (meaning the location and taper) of the cracking should be consistent with a possible known mode of foundation distortion. For instance if a brick veneer wall shows cracks that were close to each other and one was wide at the top while the other was narrow at the top, it would usually be unreasonable to consider both cracks to be due to foundation movement since they are not both consistent with a known mode of foundation distortion.

Foundation movement usually results in cracks in drywall and brick veneer at weak points such as at the corners of windows and doors. Cracks that show up after a long period of dry weather and tend to close when the weather turns wetter are usually due to foundation movement.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**Foundation movement can distort door openings causing doors and windows to stick and bind. Wallpaper may exhibit rucking at the inside corners of walls and at the intersection of walls and ceilings.**

**In some situations, finish floors can become perceptibly out-of-level. Unfortunately, floors are constructed out-of-level in some cases and foundations that undergo a normal range of movement can also become more or less out-of-level over time. Relating floor levelness to foundation movement is always based to a great degree on the judgment of the inspector, that judgment is always subjective and interpretative.**

**Brick courses, countertops and window stools can become noticeably out-of-level due to foundation distortion. These items are normally constructed to a tighter level tolerance than are floors**

**Foundation problems may result without proper maintenance on the homeowner's part. Maintenance may be accomplished by doing three things.**

- 1. Provide good drainage away from the foundation.**
- 2. Water the soils surrounding the foundation on an as needed basis.**
- 3. Be aware of the potential for adverse affects caused by trees and shrubbery.**

**Soil conditions in the area are known to be unstable. A program of conscientious watering of the soil in close proximity to the foundation to maintain consistent moisture content may help stabilize foundation movement caused by soil expansion and contraction. Should there be future issues concerning foundation condition, it is the opinion of the inspector that you consult with your builder or a licensed professional structural engineer.**

**Opinions are based on observations made without the use of sophisticated testing procedures. Therefore, the opinion expressed is one of an apparent condition and not based on absolute fact.**

It is the opinion of the inspector that the foundation appears to be functioning as intended, however there were deficiencies as described below. This opinion is based solely on the areas of the foundation, attic, exterior and interior of the structure that were accessible at the time of the inspection. Although no damage was observed at the time of the inspection, no warranty

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected	NI =Not Inspected	NP=Not Present	D=Deficiency	
I	NI	NP	D	Inspection Item

against future movement can be made.

A level was placed at various locations throughout the structure and the amount of deflection was minimal.


Exposed nail was observed but may not be limited to the north side of the structure. These should be sealed/removed and monitored on a continual basis.



**B. Grading and Drainage**

Comments:

**Proper grading and drainage is important to maintaining proper foundation performance, preventing water penetration, avoiding wood rot and preventing conditions which are conducive to wood destroying insects. It is recommended that grade be at a minimum of 4" from brick exteriors and 6" from wood/siding and grade sloped away from structure 6" in 10' to promote proper drainage.**

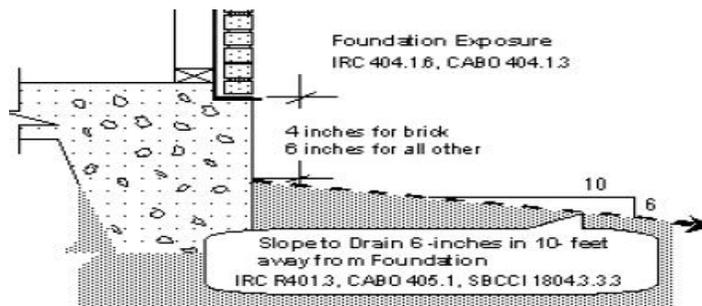

**The inspection of the grading/drainage is done by visual observation of**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**the site around the structure, including surface grade, retaining walls and rain gutters, etc. Visible conditions or symptoms that may indicate a situation which may adversely affect the foundation or indicate water penetration are reported. No soil, topographical or flood plain studies are performed.**

**Underground yard drainage systems are not checked/inspected. The inspector does not verify that yard drains operate properly and that there are no collapsed or clogged areas. The inspector (or anyone else) is unable to induce a sufficient quantity of water to determine if the system will operate properly when needed. Observe performance during heavy rains and ensure system is maintained/cleaned.**

Grading and drainage appeared to be functioning as intended.

- 
- 
- 
- 

**C. Roof Covering Materials** (If the roof is inaccessible, report the method used to inspect.)

**Type(s) of Roof Covering:** Composition

**Viewed From:** Viewed from ground with binoculars from multiple points around the perimeter of the structure however this was a limited inspection due to the west side of the roof was not visible due to other structures blocking the view. Roof not walked due to overall height and roof pitch.

Comments:

**Roof inspections are limited to the visual observation of accessible surfaces. The roof is only inspected from the roof level if it can be performed safely as determined by the inspector and without damaging the roof components. Certain types of damage/poor workmanship (improper fastening, manufacturer defects, ect.) may not be apparent at the time of the inspection therefore the inspector cannot guarantee that the roof will be free from leaks/defects, nor can the inspector determine the life expectancy of the roof.**

**This report is based on the general condition of the roof at the time of the inspection. Keep in mind roof materials have a limited life and need regular maintenance/repairs. It is opinion of the inspector that the roof and rain gutters should be kept clear of all debris and monitored on a continual basis to prevent possible future water penetration.**

Roof covering/materials appeared to be functioning as intended however there were deficiencies as described below.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

The type and installation of roof fasteners are not inspected due to the possibility of damaging the roof covering as a result lifting the roof covering.

Kickout flashing did not appear to be installed at the northeast corner of the roof at the parapet wall. This should be added to divert water away from the wall.



**D. Roof Structure and Attic** (If the attic is inaccessible, report the method used to inspect.)

Comments:

**The inspection of the roof structure and attic is performed via visual observation of the areas and components which are safely accessible at the time of the inspection.**

**Attics containing appliances requiring access shall be provided with an opening and a clear and unobstructed passageway large enough to allow removal of the largest appliance, but not less than 30 inches high and 22 inches wide and not more than 20 feet in length when measured along the centerline of the passageway from the opening to the appliance. The passageway shall have continuous solid flooring not less than 24 inches wide. A level service space at least 30 inches deep and 30 inches wide shall be present along all sides of the appliance where access is required. A light fixture with a switch at the required passageway opening and a receptacle outlet will be provided near the appliance.**

**Attic space in a Houston area home is one of the most important areas for insulation. Attic floor insulation should be at least R-19, however for increased efficiency R-30 is preferred. The following illustrates typical**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**R-values per inch for commonly used insulations.**

<b><u>Insulation Type:</u></b>	<b><u>R-Value per inch:</u></b>
<b><u>Fiberglass Blanket or Batt</u></b>	<b><u>2.9 to 3.8 (Use 3.2)</u></b>
<b><u>Expanded Polystyrene Board</u></b>	<b><u>3.6 to 4 (Use 3.8)</u></b>
<b><u>High Performance Fiberglass Blanket</u></b>	<b><u>3.7 to 4.3 (Use 3.8)</u></b>
<b><u>Loose-fill Cellulose</u></b>	<b><u>3.4 to 3.7 (Use 3.5)</u></b>
<b><u>Loose-fill Fiberglass</u></b>	<b><u>2.3 to 2.7 (Use 2.5)</u></b>
<b><u>Loose-fill Rock Wool</u></b>	<b><u>2.7 to 3.0 (Use 2.8)</u></b>

**Viewed From:** Entered attic space

**Approx. Average Thickness of Vertical Insulation:** Unknown, not accessible.


**Insulation type:** Blown

**Approx. depth on insulation:** 10"

**Attic ventilation consisted of:** Ridge Vents & Soffit Vents

**Attic structure consisted of:** Rafters, Collar Ties, Bracing & Joists

**Attic access location:** Hallway

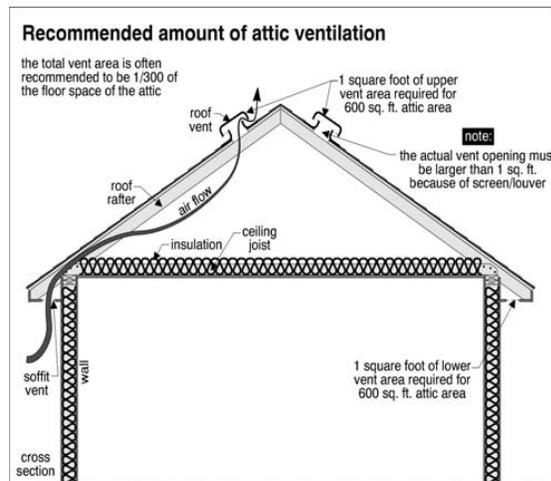

Roof structure/attic appeared to be stable and functioning as intended however there were deficiencies as described below.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

Some areas obstructed by duct work, equipment and insulation and not were accessible which limits the overall inspection of the roof and attic structure.

Electrical conductors are not protected within 6' of attic opening. Electrical conductors should be protected within 6' of the attic opening.




Insulation was observed within 3" of recessed light fixtures. Insulation should be maintained a minimum of 3 inches and wood a minimum of 1 inch from around all recessed fixtures to reduce possible fire hazard. Exception: when lights are listed and labeled as IC (insulation contact) they may be in contact with insulation. No such label was observed.



Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

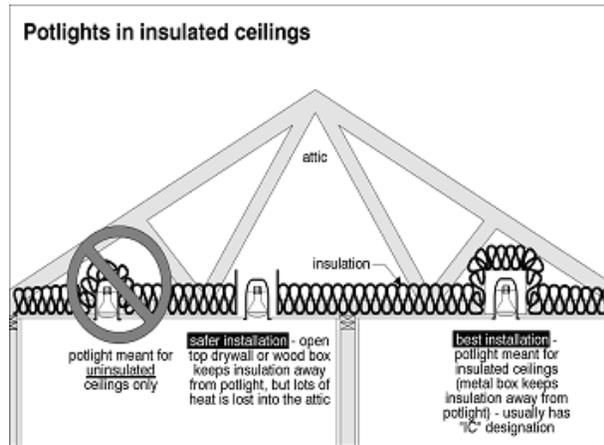

Not all the light fixtures functioned as intended in the attic area.

**E. Walls (Interior and Exterior)**

Comments:

**The condition of the framing or other components hidden behind the exterior/interior wall finishes are unknown to the inspector, therefore no opinion is given as to their current condition. The condition of the surface finishes are not noted, unless they may contribute to or be symptomatic of other issues. Home furnishing, landscaping and other personal items, ect. may limit the assessment of existing conditions.**

**Separation required. The garage shall be separated from the residence and its attic area by not less than 1/2-inch (12.7 mm) gypsum board applied to the garage side. Where the separation is a floor-ceiling assembly, the structure supporting the separation shall also be protected by not less than 1/2-inch (12.7 mm) gypsum board or equivalent.**

**Exterior Walls:**

**Type:** Stucco Facade with Cement Board/Wood Siding/Trim

Exterior walls appeared to be functioning as intended however there were deficiencies as described below.

Damage to stucco finish coat was observed at various locations on the north side of the structure. This should be repaired and monitored on a continual basis.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



A screw head protruding through the cement board was observed but may not be limited to the area above the light fixture. This should be removed and properly sealed.



Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

Z-Flashing on the south side of the structure is damaged. This should be repaired.



**Interior Walls:**

Interior walls appeared to be functioning as intended however there were deficiencies as described below.

Interior walls have been freshly/recently painted, this limits the overall inspection of the interior walls due to fresh paint possibly covering any deficiencies.

The opening below the receptacle to the left of the cook top in the kitchen needs to be properly sealed.



- 
- 
- 
- 

**F. Ceilings and Floors**

Comments:

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**The condition of the framing or other components hidden behind the interior ceiling/floor finishes are unknown to the inspector, therefore no opinion is given as to their current condition. The condition of the surface finishes are not noted unless they may contribute to or be symptomatic of other issues. Home furnishing and other personal items, ect. may limit the assessment of existing conditions.**

Ceiling appeared to be functioning as intended.

Ceilings have been freshly/recently painted, this limits the overall inspection of the interior ceiling due to fresh paint possibly covering any deficiencies.

Floors appeared to be functioning as intended.

**G. Doors (Interior and Exterior)**

Comments:

**Interior/exterior doors are inspected to determine if they are functioning properly, including locking hardware and latches. Garage doors, including automatic openers and safety devices, are inspected to determine if they are functioning properly.**

**Garage Doors & Automatic Door Openers:**

**Openings between the garage and residence shall be equipped with solid wood doors not less than 1 3/8 inch (35 mm) in thickness, solid or honeycomb core steel doors not less than 1 3/8 inches (35 mm) thick, or 20-minute fire-rated doors.**

Garage door appeared to be functioning as intended however there were deficiencies as described below

Electronic eye was installed and appeared to be functioning as intended. This is a safety device designed to reverse the door in the event an object passing under the door while closing.

**Exterior Doors:**

**Exit door required: Not less than one exit door shall be provided from each dwelling unit. The required exit door shall provide for direct access from the habitable portions of the dwelling to the exterior without requiring travel through a garage.**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**Type of lock or latch: All egress doors shall be readily operable from the side from which egress is to be made without the use of a key or special knowledge or effort.**

Exterior doors appeared to be functioning as intended.

**Interior Doors:**

Interior doors appeared to be functioning as intended.

**H. Windows**

Comments:

**Only a representative number of accessible windows may be checked for operation during the inspection. Failed thermal paned seals in insulated glass windows are not always detectable. In some conditions the inspector may not be able to detect this condition, particularly if the windows are dirty or it's raining during the inspection. The visible moisture between panes in a failed seal situation may be apparent or not, due to variations in atmospheric conditions. Windows are reported as they are observed at the time of the inspection only.**

**Type:** Double Pane Vinyl

**Exterior:**

Exterior windows appeared to be functioning as intended however there were deficiencies as described below.

Screens have not been installed.

**Interior:**

Interior windows appeared to be functioning as intended.

**I. Stairways (Interior and Exterior)**

Comments:

Stairways appeared to be functioning as intended.

**J. Fireplace/Chimney**

Comments:

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**The inspection of the fireplace and chimney is a visual inspection of the accessible components of the firebox, hearth, damper, doors, attic penetration, chimney crown and cricket. Dirty chimneys are a fire hazzard due to the accumulation of combustible creosote. Consult a certified chimney sweep annually for cleaning and inspection.**

**Type Of Fireplace:** Gas Log w/Electronic Ignition

**Damper does not have a damper block installed. In the event that gas logs are installed in the fireplace at a future date the damper should have a damper block installed to prevent the damper from being closed.**

Fireplace/chimney appeared to be functioning as intended.

**K. Porches, Balconies, Decks and Carports (Attached)**

Comments:  
Appeared to be functioning as intended.

**L. Other**

Comments:  
**Diveway:** Driveway appeared to be functioning as intended.

**Walk Way:** Walkway appeared to be functioning as intended.

**II. ELECTRICAL SYSTEMS**

**A. Service Entrance and Panels**

Comments:  
**The inspection of the electrical system is limited to the visible and accessible components at the time of the inspection. A major portion of the electrical system is hidden behind walls and ceiling finishes and are not accessible at the time of the inspection, therefore, no evaluation of performance of these items are given.**

**When it can be performed safely, as determined by the inspector, the dead front (a panel designed and located in the electrical panel to prevent exposure to the live wires within the electrical panel) will be removed to inspect the existing condition of the breakers and conductors as in relation to proper sizing and to determine if there are any signs of overheating/double tapped conductors.**

**A typical electrical system consists of two distinct components: (1) the**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

electric service entrance, and (2) the branch circuits. The service entrance determines the capacity of the electric power available to the home. The electric circuits distribute the power throughout the home. Electrical devices in a home typically use either 120 or 240 voltage electricity. The major appliances such as clothes dryers, kitchen ranges, water heaters, air conditioners, and electric heating units require 240 volts. General-purpose circuits (lighting, outlets, etc.) require 120 volts.

**Service Entrance:** Service provided from underground.

**Main Panel:**

**Brand:** Cutler Hammer

**Amps:** 150

**Type of supply wire:** Aluminum Copper 3 wire 120/240 service

**Panel Location:** Garage interior

Service entrance/panels appeared to be functioning as intended however there were deficiencies as described below.

The dead front was removed and the interior of the panel was inspected.

Unable to determine the presence of bonding at the gas and hot /cold water lines near water heater.

20 Amp breaker shows signs of what appeared to be overheating at the conductor connection/lug. This should be further evaluated by a qualified electrician.



Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

All "hot" wires on breakers should be red or black. Any other color wire should be painted or taped black to indicate that it is "hot". One or more white (neutral) wires are being used as hot wires without marking.



**B. Branch Circuits, Connected Devices and Fixtures** (Report as in need of repair the lack of ground fault circuit protection where required.)

Comments:

The inspection of the branch circuits is limited the visible and accessible components at the time of the inspection. A major portion of the electrical system is hidden behind walls and ceiling finishes and are not accessible at the time of the inspection, therefore, no evaluation of performance of these items are given.

(Ground Fault Circuit Interrupter, a safety device that senses any shock hazard and interrupts the flow of electricity in the circuit)

GFCI Protection: (Safety Protection)

Kitchen: Yes (GFCI located in kitchen)

Exterior: Yes (GFCI located in garage)

Bathrooms: Yes (GFCI located in half & master baths)

Garage: Yes (GFCI located in garage)

Type of Wiring: Copper

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------


**Ground fault interrupter**

the GFI circuitry within the outlet checks constantly for a difference between the current in the black and white wires

if there is a difference (even as little as 5 milliamps), there is a current leak (possibly through your body) and the GFI shuts down the receptacle and other receptacles downstream

**note:**

if the GFI is in the panel, the entire circuit will be shut down

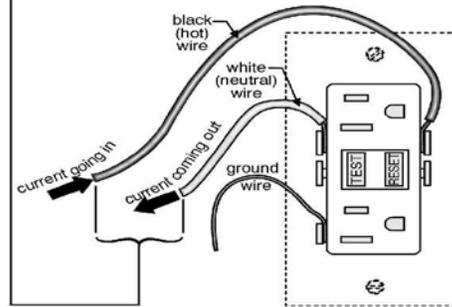

**AFCI (Arc Fault Circuit Interrupt) device protection, as required by current building standards, for all: family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreations rooms, closets, hallways, or similar rooms or areas. AFCI devices are intended to protect against fires caused by electrical arcing faults in the home's wiring. Arc faults are a common cause of residential electrical fires. Arc faults can be created by damaged, deteriorated, or worn electrical plugs, cords, and/or branch circuit conductors.**

**As of September 1, 2008, the State of Texas has adopted the 2005 NEC, which includes this requirement, as the "minimum standard" for all non-exempt electrical work. Homes built prior to 2002, generally were not required to have arc fault protection. However, the current TREC standard of practice requires inspectors to indicate that a hazardous or deficient condition exists if any home does not have this protection, regardless of date the home was constructed.**

**Electrical Fixtures:**

Electrical fixtures appeared to be functioning as intended however there were deficiencies as described below

Loose/not properly secured receptacles were observed but may not be limited to the exterior receptacle on the master bedroom balcony. These should be secured and monitored on a continual basis.

Open grounds/reversed polarity was observed but may not be limited to the receptacle on the west wall in the middle bedroom.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



Missing cover plates were observed but may not be limited to the garage. These should be installed and monitored on a continual basis.



**Smoke Alarms:**

Smoke alarms appeared to be functioning as intended.

**Note: Smoke detectors are tested using the manufacturer supplied test button only. This inspection does not include testing units with actual smoke.**

**The installation of smoke alarm(s) is required inside of all bedrooms and in any rooms designated for the purpose of sleeping, and outside within the proximity of the doors to those rooms.**

**Test all alarms and detectors weekly or monthly per manufacture instructions. The installation of carbon monoxide (CO) detector(s) is required in homes with fuel-fired appliances at every floor elevation and**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**any areas where fuel-fired equipment is located. The installation of Type ABC fire extinguisher(s) at the kitchen, laundry, and garage, if applicable, is also advised. Test all of these devices monthly. Install new batteries semi-annually. Initiate and practice plans of escape and protection for all occupants in case any emergencies arise. Failure to repair defective or install absent alarms, detectors, and other safety equipment immediately can result in serious injury or death.**

**III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS**

- 
- 
- 
- 

**A. Heating Equipment**

**Type of Systems:** Central/Forced Air

**Energy Sources:** Gas

**Mfg. Dates:** 02/2011

Comments:

**It is recommended that the heating system/air handler be professionally inspected/cleaned by a licensed technician prior to use and on an annual basis.**

**The visual inspection of the heating, ventilation and ducting equipment does not include internal parts that require disassembling of the unit to visually inspect. The condition of the HVAC equipment is based on the performance of the system when tested and those components that are visually accessible at the time of inspection. Full evaluation of the integrity of such components as a heat exchanger, require dismantling of the systems and is beyond the scope of a visual inspection.**

The heating equipment was operated and appeared to be functioning as intended.

A temperature reading was performed read 114 degrees at the north unit and 111 degrees at the south unit.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



- 
- 
- 
- 

**B. Cooling Equipment**

Comments:

**It is recommended that the cooling system be professionally inspected/cleaned by a licensed technician prior to use and on an annual basis. The inspector does not inspect the pressure of system coolant, determine the presence of leaks, program digital-type thermostats or operate setback features on the thermostats.**

**Type of System:** Central/Split System

**Sizes:** 2 tons

**Brands:** Lennox

**Mfg. Dates:** 01/2011 (south unit) 04/2011 (north unit)

Supply air temp: 63 Degrees Return air temp: 78 degrees (south unit)

Report Identification: 6013 ABC Houston, TX.


Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



Supply air temp: 67 Degrees    Return air temp: 76 degrees (north unit)

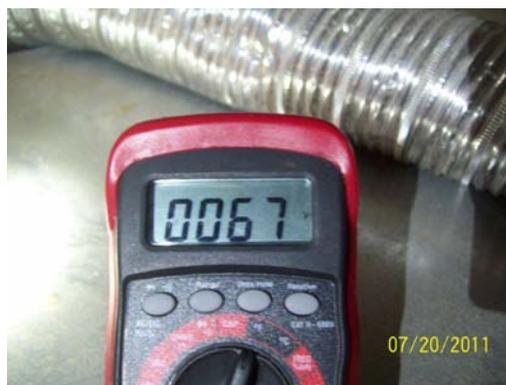

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



A variance of 15 - 20 degree between the supply and return air is considered to be functioning as intended.

The cooling equipment was operated and appeared to be functioning as intended however there were deficiencies as described below.

The north cooling equipment in the attic does not appear to be running efficiently. A variance of 15 - 20 degree between the supply and return air is considered to be functioning efficiently.

Condensation was observed in both of the secondary drain pans in the attic. Condensation was dripping from the insulation above the pans. This should be repaired and monitored on a continual basis.



Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------



**C. Ducts System, Chases and Vents:**

Comments:

**Duct Type:** Flex

Appeared to be functioning as intended.

#### IV. PLUMBING SYSTEM

**A. Water Supply System and Fixtures**

**Location of Water Meter:** Front yard

**Location of Main Water Supply Valve:** East exterior

**Static Water Pressure Reading:** 36 PSI

A reading between 40 - 80 PSI is considered acceptable.

Comments:

**A plumbing system consists of three major components, the supply piping, the waste and vent piping, and the fixtures. The supply piping brings the water to the fixture from a private well or public water main. The supply piping is smaller diameter piping that operates under pressure. These pipes must be watertight. The waste piping carries the water from the fixture to a private septic system or to a public sewer line. The drain or waste piping does not operate under pressure, instead typically uses gravity to drain the water from the fixture to the septic tank or sewer. Thus, these pipes must slope in order function properly.**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**Sinks:**

Sinks appeared to be functioning as intended however there were deficiencies as described below.

Active leak was observed under the left sink in the master bathroom. This should be repaired and should be monitored on a continual basis.



**Bathtubs/showers:**

Bathtubs/showers appeared to be functioning as intended however there were deficiencies as described below.

Unable to determine the presence of safety/tempered glass at the master shower.

**Commodes:**

Commodes appeared to be functioning as intended.

**Outside Hose Bibs:**

Hose bibs appeared to be functioning as intended.

- 
- 
- 
- 

**B. Drains, Wastes, Vents**

Comments:

**Water is run down the drains at the time of the inspection, however this cannot simulate the amount of flow that may take place during full occupancy. There may be some blockage of the drain lines from debris, broken pipes or tree roots that cannot be detected at the time of the**

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**inspection. Examination of such partial blockage is beyond the scope of this inspection.**

Appeared to be functioning as intended.

**C. Water Heating Equipment** (Report as in need of repair those conditions specifically listed as recognized hazards by TREC rules.)

**Energy Source:** Gas

**Capacity:** Instant

**Location:** Attic

**Mfg:** Rinnai

Comments:

**Water heaters should be flushed every year or as recommended by the manufacturer to remove sediments that collect at the bottom of the tank.**

**A water heater is equipped with a temperature & pressure relief (TPR) valve, (Temperature and Pressure Relief Valve, a safety valve installed on a hot water storage tank to limit the temperature and pressure of the water) This valve was visually inspected for proper installation. However, due to the likelihood that the valve would not reseal if discharged, these valves are not tested. This is an important safety device that is required by most codes.**

The water heating equipment appeared to be functioning as intended.

**D. Hydro- Massage Therapy Equipment**

Comments:

The Hydro-Massage therapy equipment appeared to be functioning as intended.

**GFCI Location:** Master commode area.

**V. APPLIANCES**

**A. Dishwasher**

Comments:

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected NI =Not Inspected NP=Not Present D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

The dishwasher was operated and allowed to run a complete wash cycle. The unit appeared to be functioning as intended.

**B. Food Waste Disposer**

Comments:  
The food waste disposer was operated and appeared to be functioning as intended.

**C. Range Exhaust Vent**

**Vent Method:** Vented to the exterior

Comments:  
The range exhaust vent was operated and appeared to be functioning as intended.

**D. Ranges, Cook Tops and Ovens**

Comments:  
**Cook Top:** Gas

The cook top was operated and appeared to be functioning as intended.

**Oven:** Electric

The oven was turned on to 350 degrees and allowed to cycle through the preheat function, a thermal reading was performed and read 340 degrees, a variance of 25 degrees is considered acceptable.

**E. Microwave Oven**

Comments:  
The microwave was operated and appeared to be functioning as intended.

**Trash Compactor**

**F. Mechanical Exhaust Vents and Bathroom Heaters**

Comments:  
The exhaust vents appeared to be functioning as intended.

Report Identification: 6013 ABC Houston, TX.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair

I=Inspected    NI =Not Inspected    NP=Not Present    D=Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

               **G. Garage Door Operators**

               **H. Door Bell and Chimes**

Comments:

Door bell/chimes appeared to be functioning as intended.

               **I. Dryer Vents**

Comments:

**We may not be able to check dry ducts for cleanliness. Dryer duct should be checked/cleaned on a regular basis.**

The dryer vent appeared to be functioning as intended.